


Original Wiring of the Lighted Switch

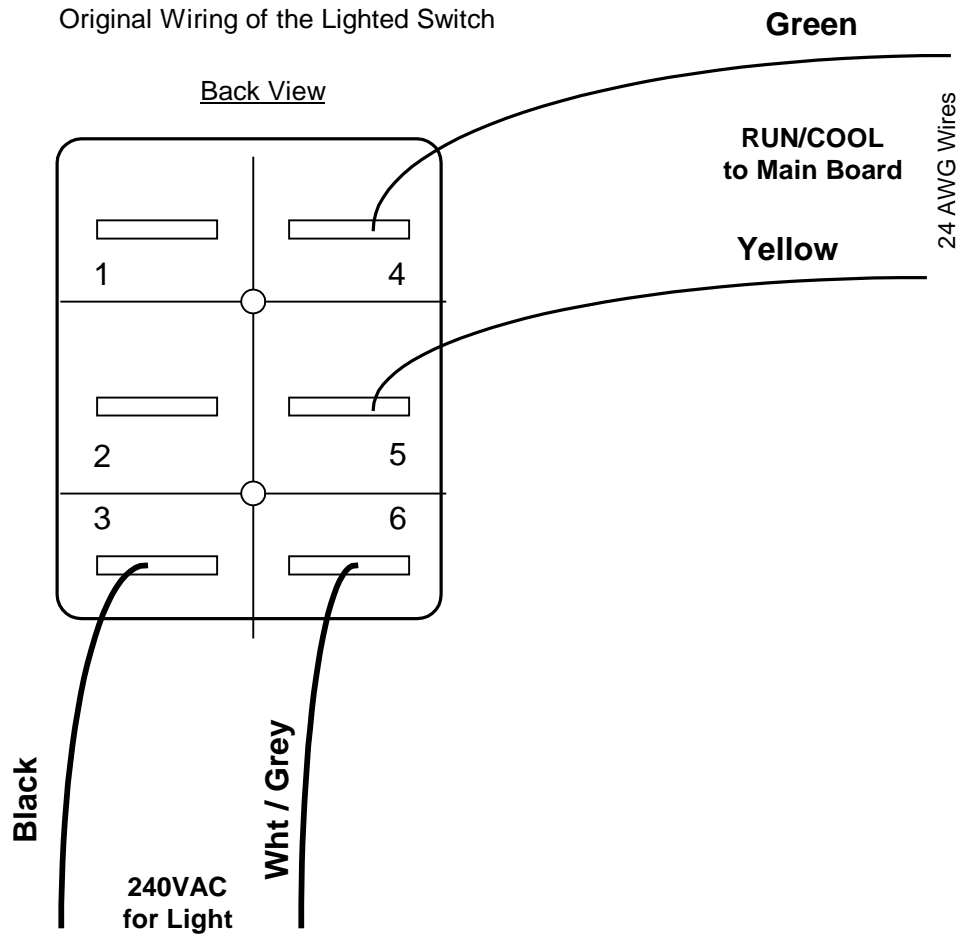

DO NOT CONNECT THESE WIRES

Kombi Rapper RUN/COOL-DOWN Switch Failure

Models: KRI, KRII, IC1620 with Pilot Light Switch

DUE TO REPEATED CATASTROPHIC MAIN BOARD FAILURE FROM FAILING RUN-COOL DOWN SWITCH, WE HIGHLY RECOMMEND TO IMMEDIATELY DISCONNECT THE LIGHT WIRES AND INSULATE.

AFTER YEARS OF OPERATION THE SWITCH BREAKES APART AND SHORTS OUT THE LINE VOLTAGE TO THE SENSITIVE PCB CONTROL VOLTAGE RESULTING IN A VERY COSTLY CONTROL BOARD DAMAGE. IF THE SWITCH IS BROKEN AND NEEDS TO BE REPLACED ORDER THE NON-LIGHTED VERSION PN: 5420-91

INSTALL A SEPARATE PILOT LIGHT IF DESIRED

See diagram on next page